


**SHEET KEYED NOTES**

- 1 14.5x5.5 EA DUCT UP FROM BELOW TO ATTIC INSIDE STUD CAVITY. SEE SHEET M203 ENLARGED MECHANICAL ATTIC PLAN FOR CONTINUATION.
- 2 BOTTOM TAKE-OFF. SEE M203 ENLARGED MECHANICAL ATTIC PLAN FOR ORIGINATION.
- 3 DOWN FROM ATTIC SPACE. SEE M203 ENLARGED MECHANICAL ATTIC PLAN FOR CONTINUATION.
- 4 MOUNT BOTTOM OF R-4 0-8" ABOVE FINISHED FLOOR.
- 5 UP TO ATTIC. SEE M203 ENLARGED MECHANICAL ATTIC PLAN FOR CONTINUATION.
- 6 MOUNT BOTTOM OF S-1 10'-0" ABOVE FINISHED FLOOR. ANGLE HORIZONTAL BLADES AT 45°.
- 7 MOUNT BOTTOM OF S-1 10'-0" ABOVE FINISHED FLOOR. ANGLE HORIZONTAL BLADES AT 22.5°.
- 8 RETURN AIR DUCT DOWN ARCHITECTURAL IN CHASE.
- 9 RA UP TO NEW DUCT DROP. SEE SHEET M203 ENLARGED MECHANICAL ATTIC PLAN FOR CONTINUATION.
- 10 12x6 SA DUCT DOWN TO BASEMENT. SEE M101 MECHANICAL PLAN FOR CONTINUATION.
- 11 ZONE DAMPER SYSTEM MANAGER-WALL MOUNTED.
- 12 EXTERIOR DUCT SUPPORT-TYP.
- 13 RTU-1 LOCATED ON SIDE DISCHARGE PLENUM CURB.
- 14 CONTINUE INTO ATTIC SPACE. SEE M203 ENLARGED MECHANICAL ATTIC PLAN FOR CONTINUATION.
- 15 MOUNT BOTTOM OF L-1 1'-0" ABOVE GRADE. SEE LOUVER LOCATION ON MECHANICAL EXTERIOR CROSS SECTION ON SHEET M301 MECHANICAL DETAILS.

**Revisions:**

No:	Date:

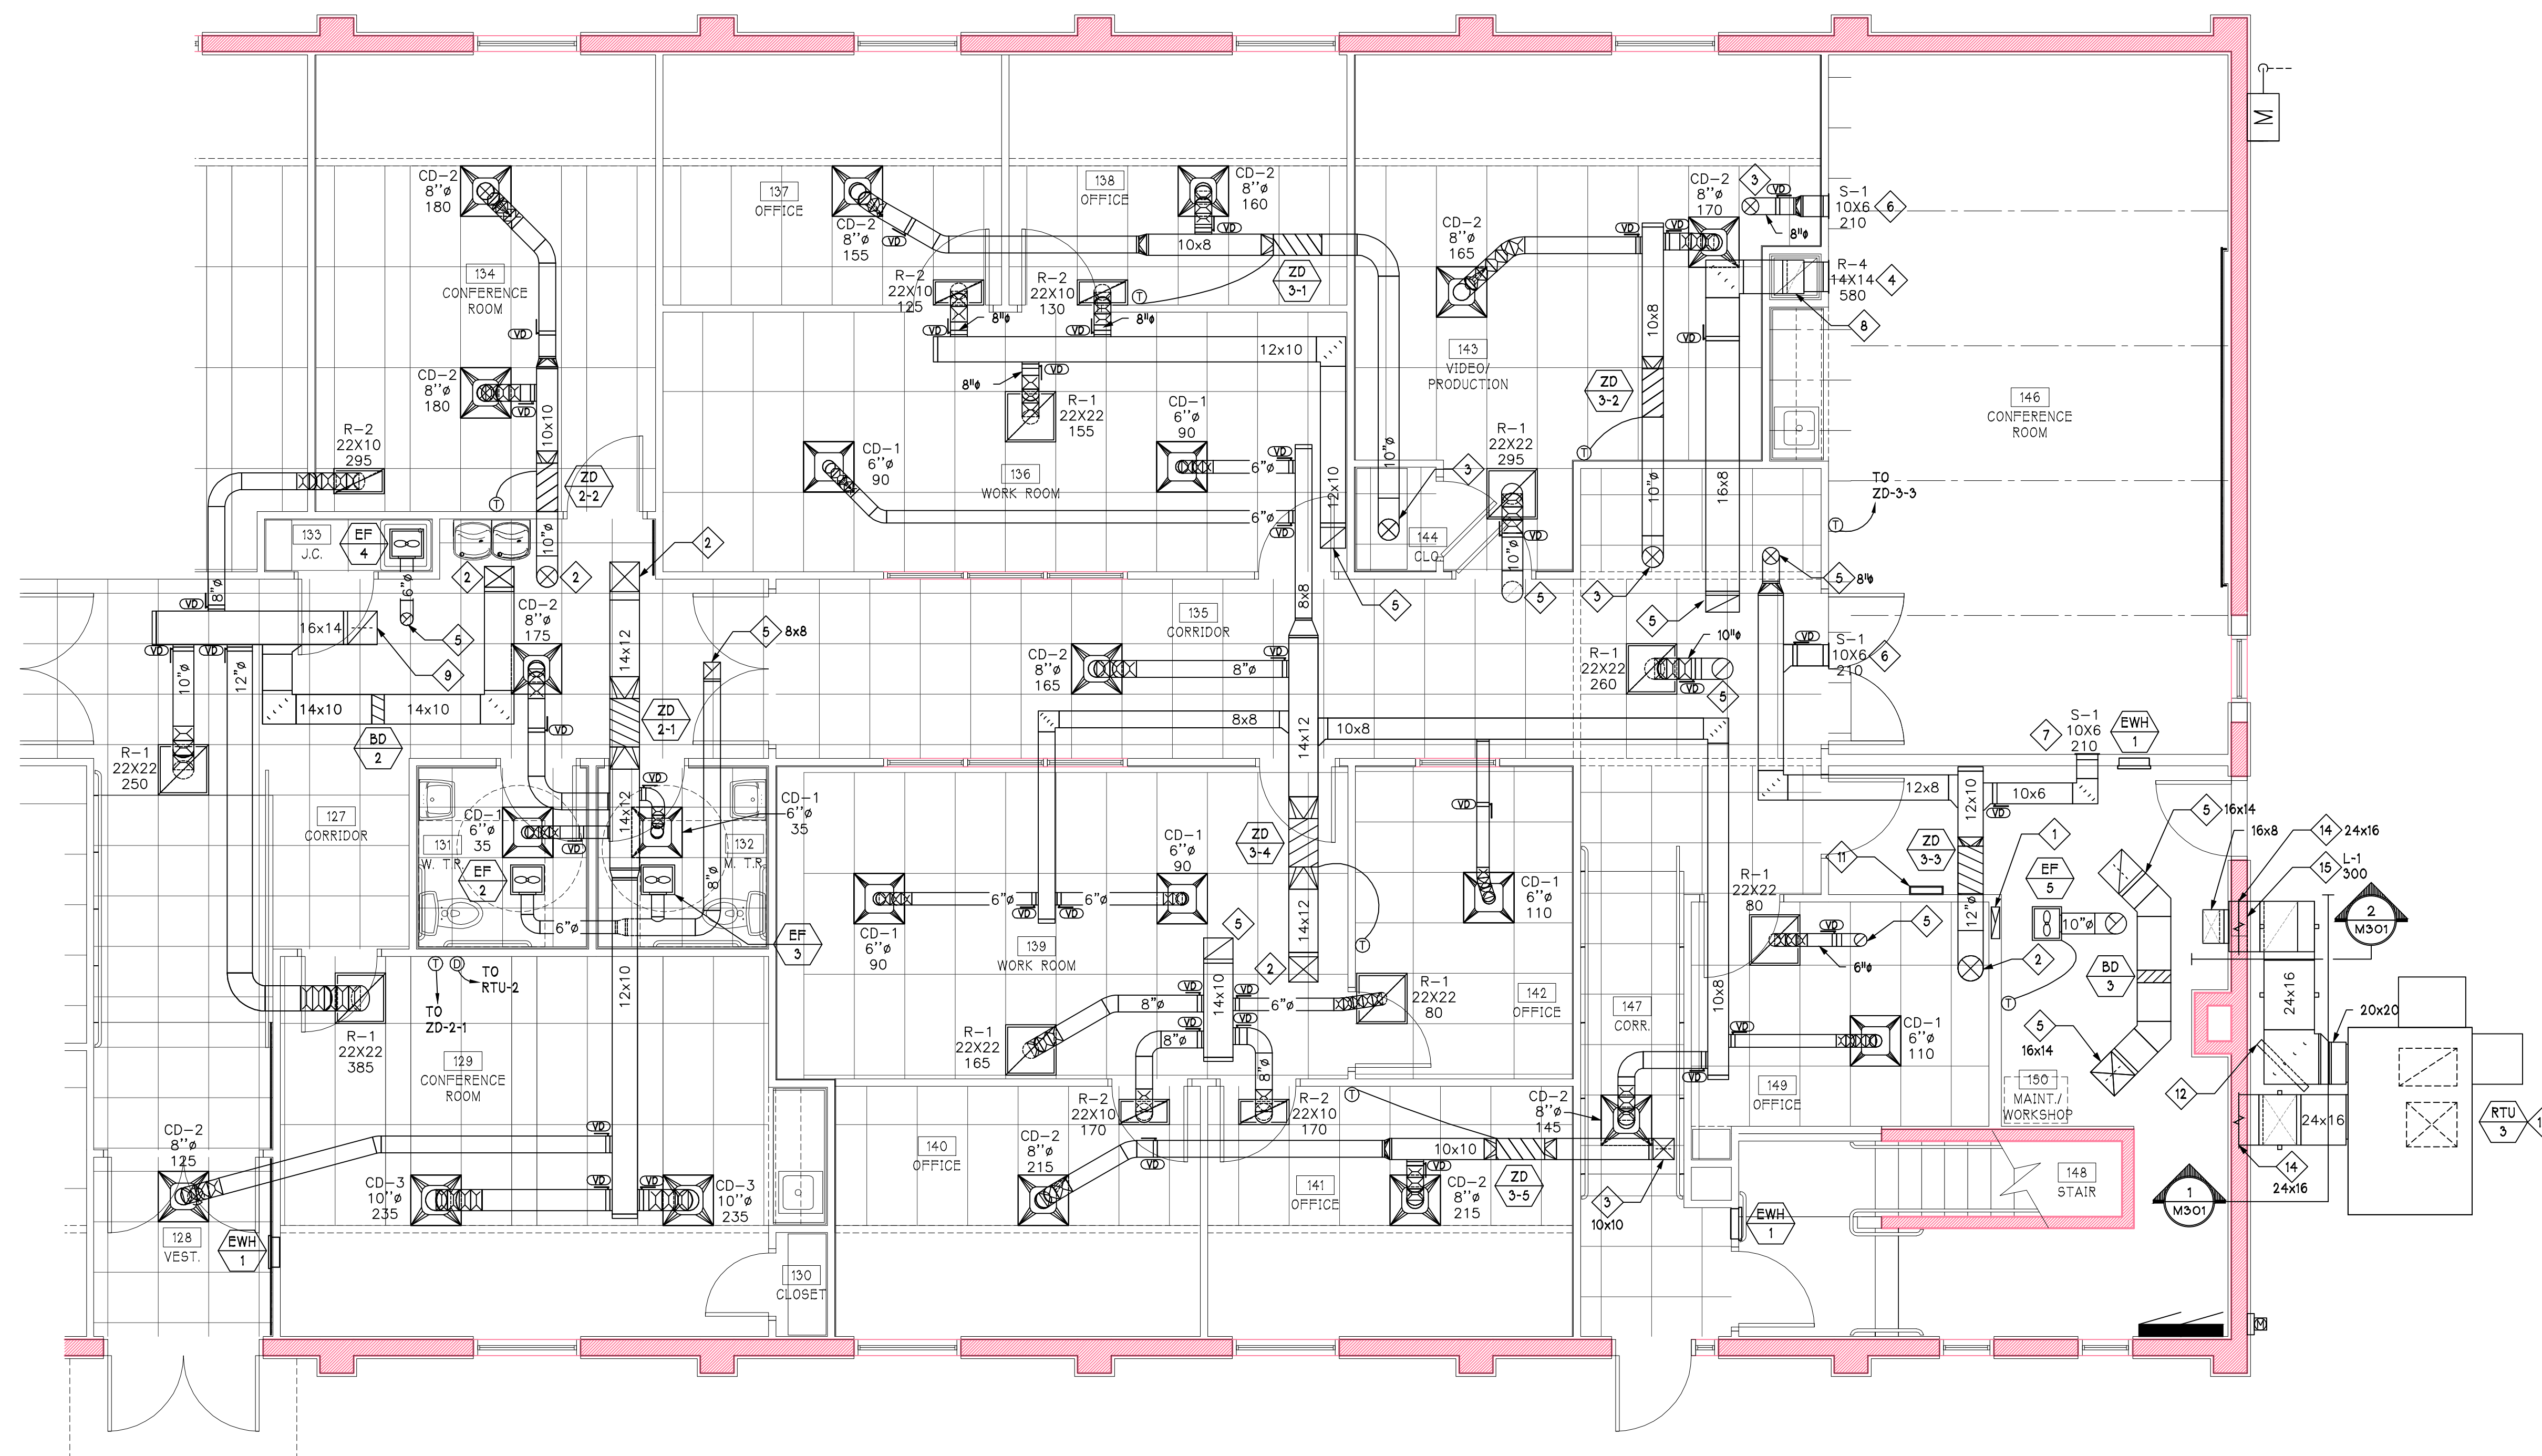

**1 ENLARGED MECHANICAL PLAN**  
 M201 1/4" = 1'-0"

**NEWCOMER ASSOCIATES**  
 architecture + engineering

1105 Shiller Avenue Chambersburg, PA 17201 Tel: 717.265.0100 Fax: 717.263.7580 www.newcomerassociates.com

**King Street Church  
 Office Building Renovation**

56 North Second Street Chambersburg, Pennsylvania 17201

© 2016 Newcomer Associates, Inc.

**Drawing Title:**  
 ENLARGED MECHANICAL PLAN

**Sheet No.**  
**M201**

Date: January 29, 2016